


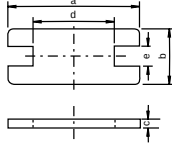



Tube Clamps Series C (Heavy Series)

DIN 3015 Part 2

								
Clamp size	Socket head IS-C	Socket head IS-C d x l	Stacking AS-C	Stacking AS-C a b m SW	Locking plate ¹⁾ SP-C	Locking plate SP-C a b c d e	Locking washer ²⁾ US-C	Locking washer US-C a b
1	IS-C 1	M10 x 45	AS-C 1	25 51 M10 15	SP-C 1	55 30 8 14 15,5	US-C 1	13 22
2	IS-C 2	M10 x 60	AS-C 2	40 66 M10 15	SP-C 2	70 30 8 26 15,5		
3	IS-C 3	M10 x 70	AS-C 3	52 78 M10 15	SP-C 3	85 30 8 41 15,5		
4	IS-C 4	M12 x 100	AS-C 4	85 112 M12 17	SP-C 4	115 45 10 69 17,5	US-C 4	15 28
5	IS-C 5	M16 x 130	AS-C 5	110 146 M16 21	SP-C 5	152 60 10 97 21,5	US-C 5	18 32
6	IS-C 6	M20 x 190	AS-C 6	155 206 M20 27	SP-C 6	205 80 15 137 27,5	US-C 6	21 36
7	IS-C 7	M24 x 220	AS-C 7	185 245 M24 30	SP-C 7	250 90 15 169 30,5	US-C 7	25 42
8	IS-C 8	M30 x 300	AS-C 8	250 330 M30 36	SP-C 8	320 120 25 219 36,5	US-C 8	32 52

P
A
G
E**BACK TO**

¹⁾ The use of stacking screws necessitates the deployment of locking plates during the construction assembly!

²⁾ When assembling solid rubber clamps, covering plates, hexagon screws and locking washers must be used.

All metal parts available in stainless steel.

CATALOGUE